



# Air Transportation Safety Investigation Brief A16W0094

## **COLLISION WITH TERRAIN**

North American Aviation Inc. T-28B, C-GKKD  
Canadian Forces Base Cold Lake, Alberta  
17 July 2016

### **About the investigation**

The Transportation Safety Board of Canada (TSB) conducted a limited-scope, fact-gathering investigation into this occurrence to advance transportation safety through greater awareness of potential safety issues. It is not the function of the Board to assign fault or determine civil or criminal liability.

**This is a new type of report that is part of a TSB pilot project to modernize its investigation processes and products.**

### **History of the flight**

The pilot of a privately registered North American Aviation Inc. T-28B aircraft (registration C-GKKD, serial number 138362) had been engaged to provide an aerobatic demonstration for the 2016 Cold Lake Air Show at Canadian Forces Base (CFB) Cold Lake (CYOD), Alberta, on 16 and 17 July 2016. He had arrived on 14 July to participate in the practice day, scheduled for 15 July.

On 16 July, the first day of the air show, the pilot performed the aerobatic routine without incident.

On 17 July, the pilot arrived at the airfield at 0830<sup>1</sup> to participate in the pre-show briefing and prepare for the routine.

At 1325, C-GKKD's engine was started and the aircraft taxied to the holding area for the take-off sequence.

At 1340, C-GKKD took off, and, at 1345, the 12-minute aerobatic demonstration began. Several still images and videos were captured throughout the demonstration.

---

<sup>1</sup> All times are Mountain Daylight Time (Universal Coordinated Time minus 6 hours).

The first half of the demonstration consisted mainly of aerobatic manoeuvres performed as listed in a submission to the air show operator (Text box 1). However, rather than a slow roll (item 8), the pilot flew what appeared to be half of a lazy eight followed by a half reverse Cuban, which was performed at show right<sup>2</sup> to accomplish the reversal. It is not unusual for an aerobatic performer to modify the order of manoeuvres in a routine to compensate for conditions or for positioning. Such alterations are acceptable provided that they are consistent with the manoeuvres in the planned routine.

The pilot flew from show right to left at about 500 feet above ground level (AGL) within the defined airspace for the routine, then entered a roll just before show centre. As the aircraft reached the inverted position, the roll stopped and the nose began to pitch toward the ground. The aircraft elevator was seen to move to full up deflection as the aircraft continued toward the ground in an arc until its collision with terrain, in a near-vertical position with a slight right roll (Figure 1).

The pilot was fatally injured. No air show personnel or spectators were injured.

**Text box 1. The aerobatic routine, as submitted to the air show operator, for demonstration by C-GKKD**

1. High speed entry– show left
2. Vertical loop
3. Non-aerobatic wing-over reversal
4. Four-point roll
5. Non-aerobatic wing-over reversal
6. Barrel roll
7. Non-aerobatic wing-over reversal
8. Slow roll
9. Half-Cuban eight reversal
10. Non-aerobatic lazy eight
11. Non-aerobatic wing-over reversal
12. Vertical loop
13. Climbing aileron roll
14. Climbing left turn to exit aerobatic box
15. Topside canopy photo pass

## Wreckage and impact information

The aircraft struck the ground at a high velocity, in a near-vertical attitude. It was destroyed by impact forces. The impact site was located among several structures used for provision of airfield services. These included the buildings that housed the precision approach radar equipment and its backup power generator, and twin 1000-gallon propane tanks (Figure 2).

Debris from the aircraft penetrated the walls of the backup power generator building; however, there was no significant damage to any of the infrastructure and it remained operational.

All major components of the aircraft were accounted for at the accident site. Based on the examination of the wreckage, and on the information from the photographs

**Figure 1. Composite image of 2 photographs taken 3 minutes apart. The upper portion of the image was photographed just prior to impact, and the lower portion during the emergency response.**



<sup>2</sup> "Show right" means the right-hand side of the performance area as viewed by the spectators.

and videos collected, it was determined that the engine and flight controls had been operating normally prior to impact.

There was no post-impact fire.

### Emergency response

As per the air show emergency response plan, airport rescue firefighting services responded, arriving at the site 1 minute and 34 seconds after the impact.

Announcements were made to spectators, directing them to remain calm and stay where they were. The air show was immediately suspended during the emergency response, and the remainder of the show was eventually cancelled.

### Aircraft information

C-GKKD was a North American Aviation Inc. tandem-seat, low-wing, all-aluminum T-28B aircraft equipped with retractable tricycle landing gear (Figure 3). It was manufactured in 1954 and was originally used as a training aircraft by the United States Navy.

The T-28B was designed for approved basic aerobatics required in the training of naval aviators, including inverted flight not to exceed 10 seconds, loops, Immelmann turns, aileron rolls, wing-overs, chandelles, upright spins, barrel rolls, and half Cuban eights.

The pilot involved in the accident had first flown the aircraft in November 2007, when it was registered as N4689P. He then trained on it, purchased it, and arranged to import it into Canada.

On 16 January 2008, N4689P entered Canada.

On 13 May 2008, an import inspection was completed.

On 28 May 2008, Transport Canada (TC) issued a special certificate of airworthiness limited<sup>3</sup> for C-GKKD.

C-GKKD was powered by a Curtiss-Wright R-1820-86B radial engine. Its last engine overhaul had been performed on 27 February 2012. At the time of the accident, the engine had accumulated

Figure 2. Aerial photograph of the accident site, located near the precision approach radar facility (Source: Department of National Defence)



Figure 3. C-GKKD, pictured at Canadian Forces Base Cold Lake on the day of the accident (Source: Department of National Defence)



<sup>3</sup> A special certificate of airworthiness limited is issued under *Canadian Aviation Regulations* (CARs) subsection 507.03(5) for an aeroplane of a type that has been accepted for use in the military service and that is approved by the Minister for operations other than those conducted under CARs Part IV or VII.

approximately 210 hours since the overhaul, and the aircraft's total time since new was approximately 15 740 hours. An annual inspection was completed on 09 April 2016. No outstanding defects were noted in the maintenance or aircraft logbooks, and the aircraft had been operated within its weight-and-balance and design limits.

## **Weather**

The Cold Lake hourly weather observation recorded at 1400 (9 minutes after the accident) reported winds from the northwest at 5 knots, visibility greater than 15 statute miles, a few clouds at 6000 feet and 25 000 feet AGL, and a temperature of 22 °C. Weather conditions were not considered a factor in the accident.

## **Pilot**

The pilot earned a private pilot licence on 21 December 1993, a commercial pilot licence on 07 October 1995, and an airline transport pilot licence on 16 January 2015. At the time of the accident, he possessed a current Group 1 instrument rating and a Class 1 medical certificate that was valid until 01 August 2016. He had accumulated 4043.2 flying hours, 461.5 of which were on the T-28B. He had flown 7.8 hours in the 90 days before the accident, and 34.4 hours in the previous 12 months.

On 09 October 2014, the pilot received a special flight operations certificate (SFOC) from TC, valid until 09 October 2016, to conduct aerobatics below 2000 feet AGL. The certificate allows the practice of low-level aerobatics over unpopulated areas with the permission of the respective land owners of those areas. On 15 June 2015, a statement of aerobatic competency, level 3 (500 feet), valid until 31 December 2016, was issued to the pilot, permitting him to perform aerobatics at an approved air show to a minimum altitude of 500 feet AGL.

During the 2015 season, the pilot performed in the following air shows without incident:

- 18–19 July 2015, Springbank, Alberta
- 28–29 July 2015, Fort St. John, British Columbia
- 14–15 August 2015, Comox, British Columbia
- 21–23 August 2015, Edmonton, Alberta

The Cold Lake Air Show was the first air show of the 2016 season in which the pilot performed. He had practised for the aerobatic routine on 2 dates prior to the air show: 02 April 2016, for 0.9 hours, and 15 May 2016, for 1.5 hours.

## **Air show management and oversight**

Air shows in Canada must undergo an extensive approval process with TC. The requirements for an SFOC are detailed in *Canadian Aviation Regulations* (CARs) Subpart 603 and CARs Standard 623.

An air show operator must submit a comprehensive plan detailing how the air show will be operated and how it will meet all of the airspace restrictions that ensure the safety of the viewing crowd and the general public. The submission must include an emergency response plan and a layout of the show box<sup>4</sup> and show lines (Figure 4). No routine may direct energy toward the crowd.

---


<sup>4</sup> The show box is the area within which air show performers must remain while conducting aerobatic routines.



The show lines run parallel to the edge of the crowd at specific distances. Each performer must submit a planned routine to the air show operator, along with their proof of qualifications, licences, and insurance that are applicable to the type of aircraft and routine to be performed. Each of these items is reviewed and verified by TC before the SFOC is issued.

A TC inspector is then in attendance for at least 1 air show day to monitor the event and ensure compliance with the approved plans.

**Figure 4. Layout of the Cold Lake Air Show, as submitted by Canadian Forces Base Cold Lake (Source: Department of National Defence)**

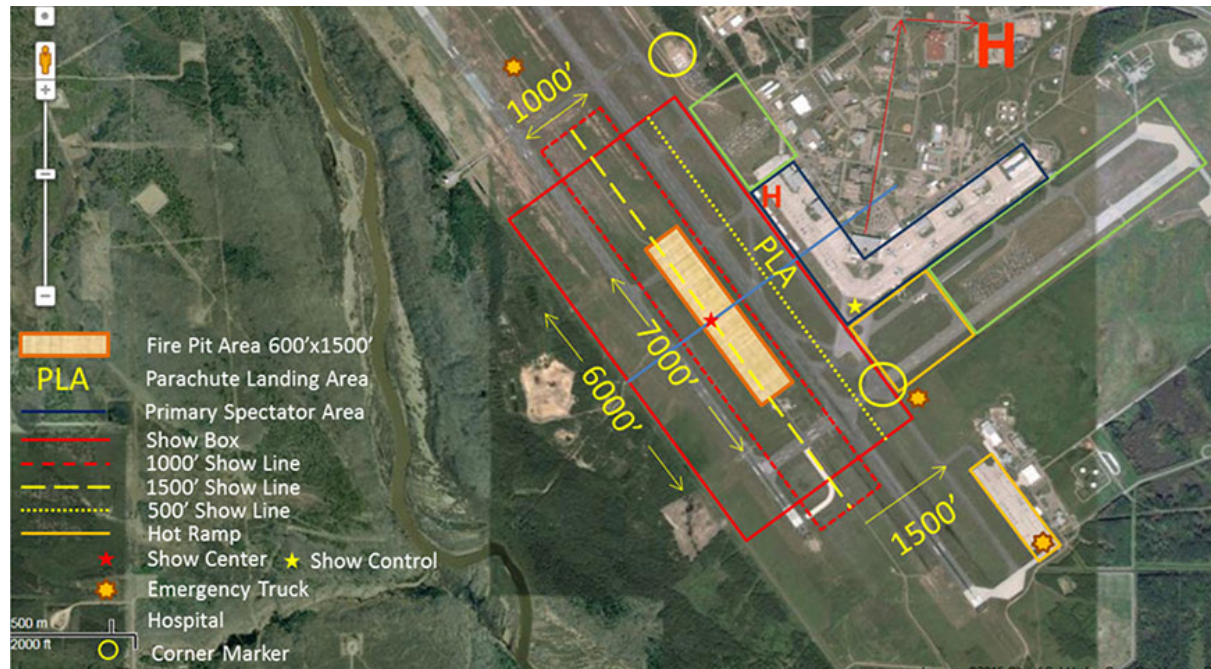

An SFOC was issued to the Commander of 4 Wing Cold Lake on 06 July 2016 and was valid until 1730 on 17 July 2016. The pilot of the T-28B was authorized by TC and the air show operator to perform the submitted routine no lower than 500 feet AGL on the 1000-foot show line. A TC inspector was present for the practice day on 15 July and on the 1st show day, 16 July. The inspector was not in attendance on the day of the accident.

*This concludes the TSB's limited-scope investigation into this occurrence. The Board authorized the release of this brief on 06 December 2017. It was officially released on 05 January 2018.*

Transportation Safety Board of Canada  
Place du Centre  
200 Promenade du Portage, 4th floor  
Gatineau QC K1A 1K8  
819-994-3741  
1-800-387-3557  
[www.tsb.gc.ca](http://www.tsb.gc.ca)  
[communications@tsb.gc.ca](mailto:communications@tsb.gc.ca)

© Her Majesty the Queen in Right of Canada, as represented by  
the Transportation Safety Board of Canada, 2018

Air transportation safety investigation brief A16W0094

Cat. No. TU3-10/16-0094E-PDF  
ISBN 978-0-660-24394-8

This report is available on the website of the  
Transportation Safety Board of Canada at [www.tsb.gc.ca](http://www.tsb.gc.ca)

*Le présent rapport est également disponible en français.*